

# Manhole Inspection Summary

Manhole # S29I\_\_028MH

Printed On: 3/20/2009

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **29I** Node: **028** Status: **Found**

Insp Date: **1/22/09 1:02 PM**

Incomplete Comments

Crew: **WJ/DH**  
Inspector: **dhinton**  
Firm: **PER**

**Location** Address: **111 Lemmon St.**

Cross Street: **Penn St.**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)  
**5**

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **12** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel** Material: **Concrete** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Concrete** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench** ☒ Exists Material: **Concrete** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Concrete** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **3** Missing: **0** ☐ Corroded

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **5** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S29I\_\_028MH

Printed On: 3/20/2009

Page 2 of 4

Location View



Top View



Miscellaneous



MH Lid

Defect 2



corbel joint infiltration, surcharge evidence

Defect 1



chimney deteriorated with mortar & joint infiltration

## Manhole Inspection Summary

Manhole # S29I\_\_028MH

Printed On: 3/20/2009

Page 3 of 4

10 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **7.94** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**


Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer  
Pipe In @ 3 O'Clock

3 O'Clock Inflow

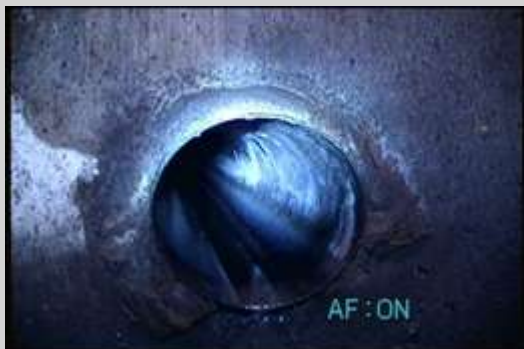

Pipe Height: **10.8** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **7.06** (ft.) Flow Characteristics: **None**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S29I\_\_028MH

Printed On: 3/20/2009

Page 4 of 4

6 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: **6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.52** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection